

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-022011**Date Inspected:** 21-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Lv Li Qing**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance(QA) Inspector Mr.Shrikant Utekar was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. The QA Inspector observed and/or found the following:

BAY # 14

MAGNETIC PARTICLE TESTING

ZPMC NWIT No: 08354

This QA Inspector performed Magnetic Particle Testing (MT) of approximately 15% of the length previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an (MT) report on this date. The members are identified as OBG 13AE. The weld designations are as follows:

SEG3007G-021, 022, 023, 024

This QA Inspector randomly observed the following work in progress.

OBG 14EAST

This Quality Assurance (QA) Inspector observed ZPMC qualified welder 068097 performing the Shielded Metal

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Arc Welding process on weld 006 located at PCMK SEG3019Z. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-Tc-u5b-Fcm.

This Quality Assurance (QA) Inspector observed ZPMC qualified welder 068917 performing the Shielded Metal Arc Welding process on weld 007 located at PCMK SEG3019X. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-Tc-u5b-Fcm.


This Quality Assurance (QA) Inspector observed ZPMC qualified welder 066179 performing the Shielded Metal Arc Welding process on weld 137 located at PCMK SEG3019AB. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-Tc-u5b-Fcm.

This Quality Assurance (QA) Inspector observed ZPMC qualified welder 066733 performing the Flux Cored Arc Welding process on weld 077 located at PCMK SEG3019S. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-T-2233-ESAB.

This Quality Assurance (QA) Inspector observed ZPMC qualified welder 066763 performing the Flux Cored Arc Welding process on weld 260 located at PCMK SEG3019N. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-T-2233-ESAB.

This Quality Assurance (QA) Inspector observed ZPMC qualified welder 066439 performing the Flux Cored Arc Welding process on weld 122 located at PCMK SEG3019AY. ZPMC QC Mr. Zhong Guo Hui was monitoring this welding operation. The welding variables recorded by QC appeared to comply with WPS-B-T-2233-ESAB.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

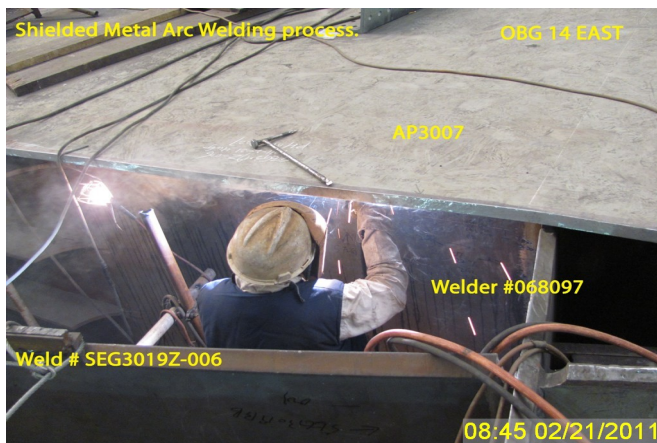

Summary of Conversations:

No significant conversations were reported on this date.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang, +(86) 1500 042 2372, who represents the Office of Structural Materials for your project.

Inspected By:	Utekar,Shrikant	Quality Assurance Inspector
Reviewed By:	Patterson,Rodney	QA Reviewer
